




Nº 131 SERVICE BULLETIN

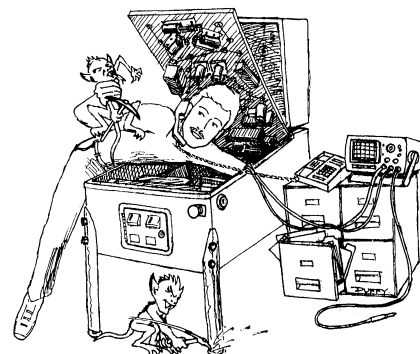

Joe Blackwell
Director, Parts Sales &
Technical Support

Susan White
Parts Sales
Manager

Patty Schrap
Parts Stockroom
Manager

Chas Siddiqi
Technical Support
Engineer

Jay Alfer
Technical Support Doc.
Administrator

TO: Parts & Service Managers

DATE: January 23, 2002




SUBJ: Electric Company Sign / Backbox J2 Harness Re-dress

Service Advisory:

The **J2 Harness** that carries the data from the I/O Bd. to the Electric Co. Sign has been dressed in such a way that it is picking up electrical noise/surges from the **J17 A.C. Harness**. This harness is used to supply the A.C. voltages to the I/O Board from the secondary of the transformer. See the "**BEFORE**" picture of the I/O Board which shows the **J2 Harness** wrapped around the **J17 Harness**. If left alone (wires wrapped around J17 harness), it could cause damage to the I/O Board or the Electric Company Sign.

Note:

This *may or may not* affect your game. We feel it is important as a **precautionary measure** to re-dress the cable even if you do not have the following symptoms.

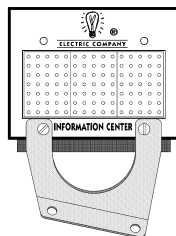

Symtom:

Electric Company Sign shows garbled information.


Problem:

I.C.'s **U201** and/or **U206** have failed on the I/O Power Driver Board.

Solution:

Re-dress **J2 Harness** (I/O Bd. Aux. Out) away from the **J17 Harness** (I/O Bd. Transformer). See the "**AFTER**" picture of the I/O Board which shows the **J2 Harness** re-dressed & separated from the **J17 Harness**.

Please phone or eMail with any questions or comments at the below numbers or address.

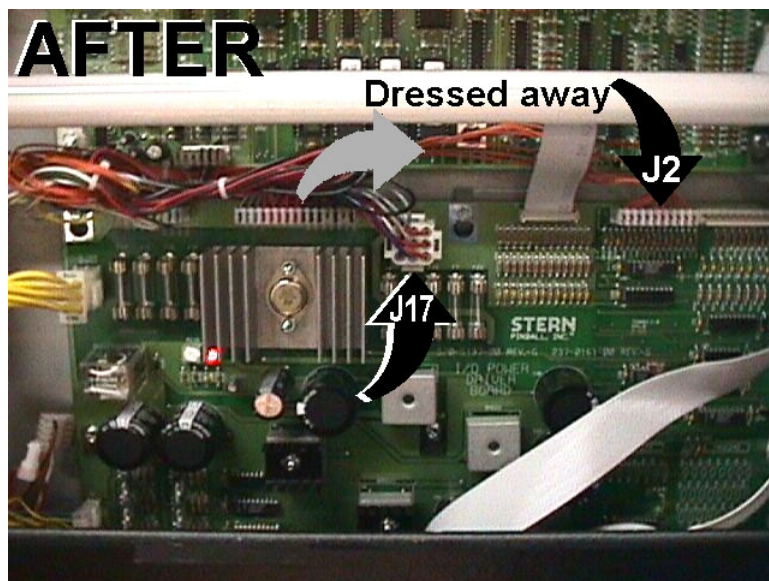

• 2020 Janice Ave • Melrose Park, IL 60160 • Tel 708-345-7700 (Option 1) • Toll-Free (USA/Canada) 1-800-542-5377 • Fax 708-345-7889 •