


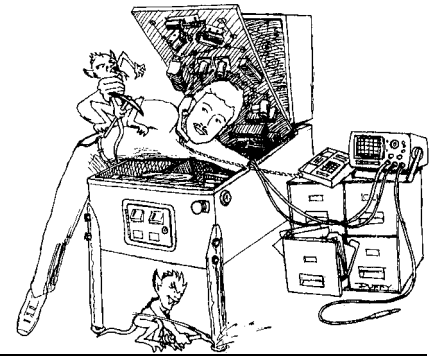

Nº 137 SERVICE BULLETIN



Joe Blackwell
Director, Parts Sales &
Technical Support

Susan White
Parts Sales
Manager

Patty Schraps
Parts Stockroom
Manager

Chas Siddiqi
Technical Support
Engineer

Jay Alfer
Technical Support Doc.
Administrator

TO: Parts & Service Managers

DATE: July 22, 2002

SUBJ: Austin Powers CPU Game ROM v3.01 Bug.



First Please Note:

If you currently have **Austin Powers CPU EPROM (Game ROM) v3.00**, you're fine. *The optional new version 3.01 created, was to enhance switch closures allowing for a smoother playing game. However, if you currently have v3.01, you will need to replace it with v3.02.*

Symptom:

With CPU/OPSYS EPROM (Game ROM) **U210 v3.01** in place on the CPU/Sound Board: If the player does not achieve (score) the **Skill Shot*** and the ball subsequently drains, the ball will be put back in play repeatedly without advancing to the next ball. * **Austin Powers Skill Shot:** *The opening shot from the plunger at the beginning of each ball, closing either Top Lane Switch #47 or Switch #48.*


Explanation:

This version of software had an unforeseen bug which has been exterminated in v3.02. *This is a software problem ONLY with version 3.01.*

Solution:

Replace only the **Game ROM** with v3.02 in the **U210** position on the **CPU/Sound Board**. This Game ROM is available from our distributors or can be downloaded for free from our web site. *To find a local distributor or to download, visit www.sternpinball.com.*

Please phone or eMail with any questions or comments at the below numbers or address.

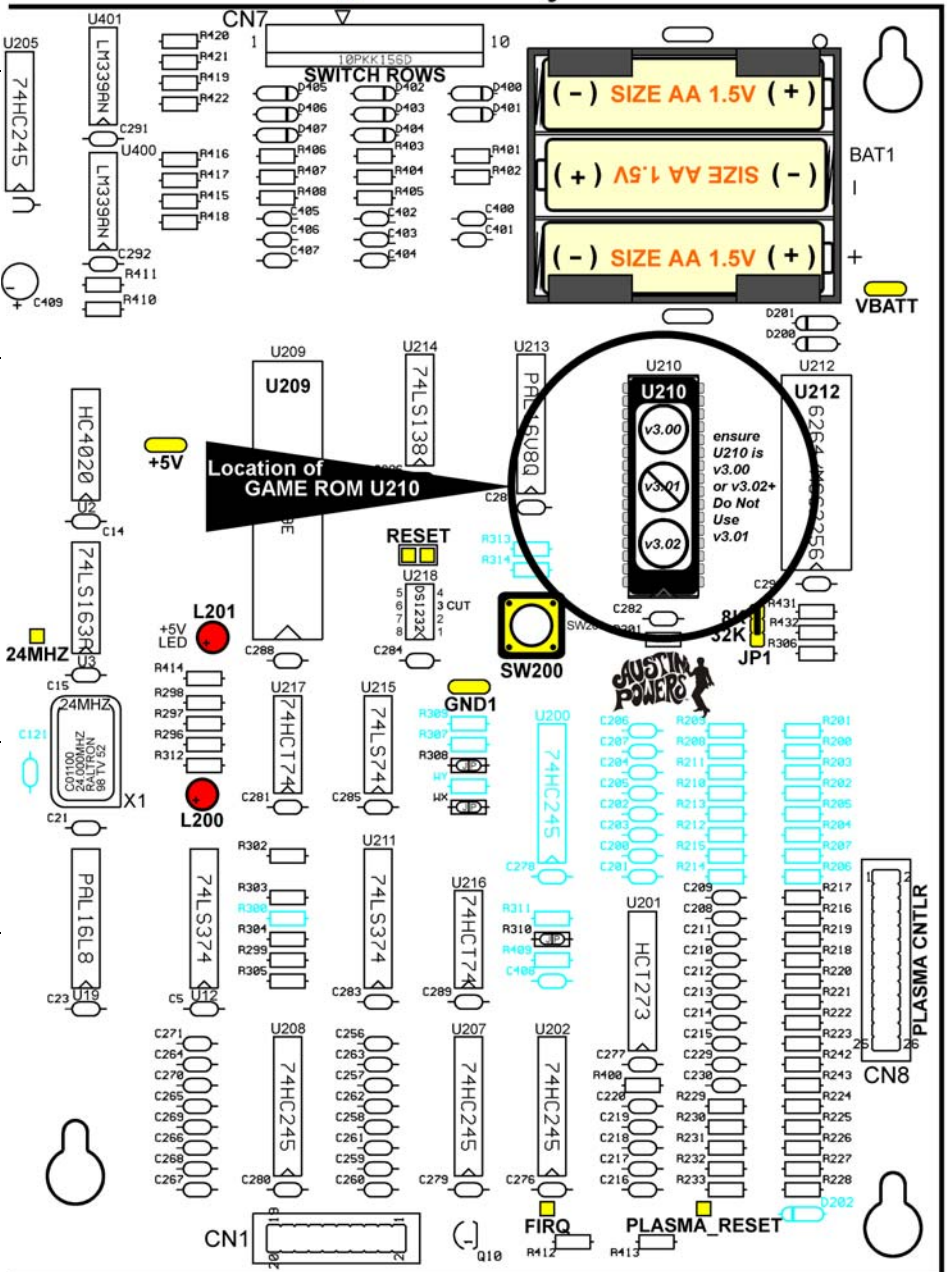

• 2020 Janice Ave • Melrose Park, IL 60160 • Tel 708-345-7700 (Option 1) • Toll-Free (USA/Canada) 1-800-542-5377 • Fax 708-345-7889 •

Received via Fax? For a better copy, download from our website: www.sternpinball.com/bulletins.htm

S.B. Nº 137
Page 1 of 1

Want Service Bulletins by eMail? Request by eMail: parts.service@sternpinball.com