



**SERVICE BULLETIN 36
(Reprint)**

FROM: Field Service Dept., Data East Pinball, Inc.

TO: Service Managers

DATE: July 20, 1992

RE: Lethal Weapon 3 Flippers

Symtom: The flippers appear weak on some Lethal Weapon 3 games, making it difficult to complete the ramp shot(s).


Cause: The flipper bat is not aligned properly with respect to the return lane guides. The bats are probably pointed too low, resulting in an inadequate striking angle on the ball.

Solution: Loosen the socket head screw connecting the Plunger Link & Pawl Assembly to the bat and align each flipper with respect to the plastic return lane guides. (See attached drawing).

If you have any questions, please contact Jim or Arnie in the Data East Service Department.

SERVICE BULLETIN 36

*ADJUST FLIPPERS UP TO BE
INLINE WITH PLASTIC RETURN
LANE GUIDES.*

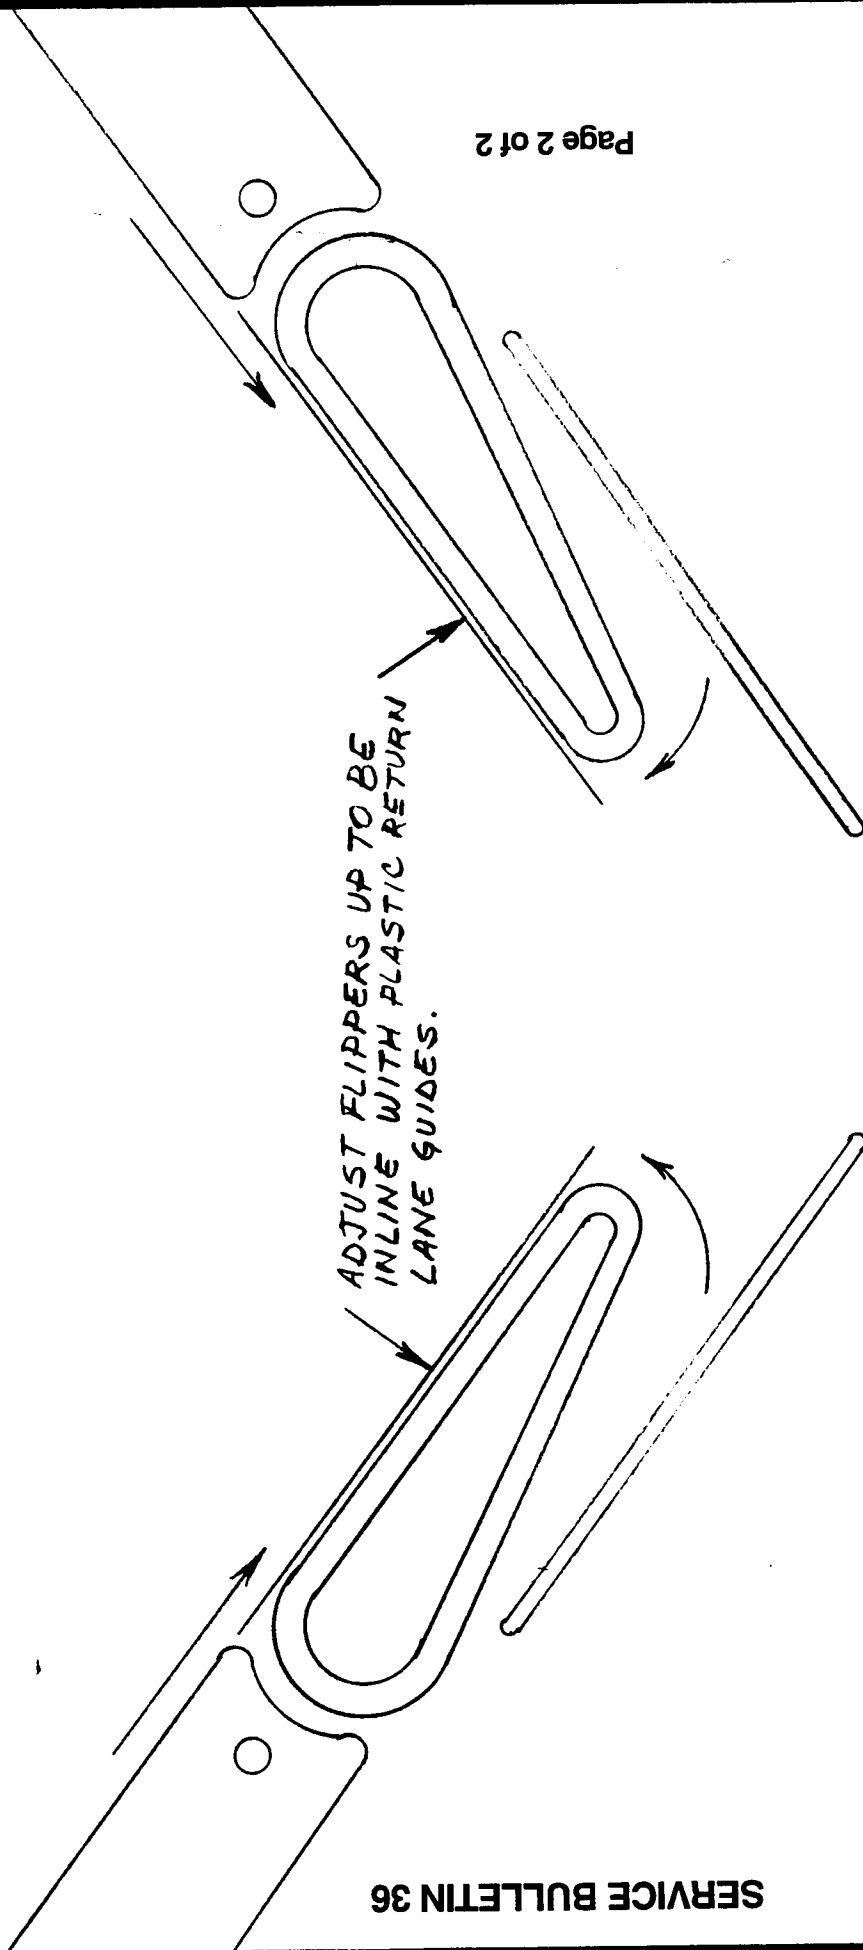

Page 2 of 2

APP.

DATE

BY

DESCRIPTION

REV.

TOLERANCE UNLESS
OTHERWISE SPECIFIED

DIM. X.X ± .05 X.XXX ± .005
X.XX ± .015 X.XXXX ±

ANGULAR
XX ± 5° FRACTIONAL ± 1/64
XXX ± .1°

REQ.	NEXT ASSEM.	DWN.	DATE	TITLE
MAT.		CH'KD.	SCALE	<i>FLIPPER ADJ. / LETHAL WEAPON</i>
H.T.				<i>3</i>
FIN.				PART NO.

DATA EAST PINBALL, INC.
1990 JANICE AVE., MELROSE PARK, IL 60160