



DATA EAST PINBALL, INC.

To: Service Manager
 From: Data East Pinball Service Department
 Date: 2 April, 1993
 Subject: Service Advisory/Ball draining from right to left orbit shot on Rocky and Bullwinkle.

Symptom- Shooting the ball, using the left flipper to accomplish the right to left orbit shot, results in the ball exiting the playfield between the 2 Flippers.

Cause-The left flat rail may not remain properly aligned with the artwork due to the elasticity of the material and an insufficient number of support brackets on the side rail.

Remedy- Using the attached drawing as a guide, secure a small post with a #8x1" machine screw behind the left side of the flat rail. This is the area right above the Hat Trick Standup Targets. Before tightening the screw make sure the flat rail is properly aligned with the artwork.

If you have any questions or comments please notify Jim or Arnie at 800-542-5377.

