



## Service Bulletin No. 044

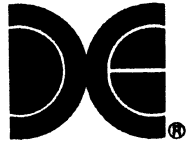

Data East Pinball, Inc.  
1990 Janice Avenue  
Melrose Park, IL 60160  
Tel: 1-800-KICKERS or Fax: 708-345-0010

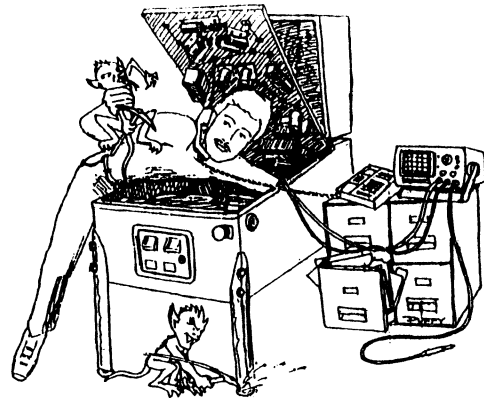

# Technical Support

---

TO: Service Managers  
FROM: Joe Blackwell  
DATE: October 18, 1993  
RE: Last Action Hero/Jurassic Park - Flipper Return Springs

Symptom: When flipper is energized it does not return to its rest position after releasing the flipper button.

Problem: Flipper return spring has broken off the spring bracket (FIG. 1). We have found a number of these machines which have had the end of the spring crimped to the spring bracket to secure it from popping off. This is not necessary and will cause premature spring failure.

Solution: Replace spring (Part No.: 265-5029-02). This is not a modified spring, it is an exact replacement part without the crimp.

Note: I am sending you along with this Service Bulletin, a package of one hundred (100) flipper return springs (PN: 265-5029-02). This should cover your stock if you or your customers should have a problem.

**(Figure 1)**

