



DATA EAST PINBALL, INC.

SERVICE BULLETIN

ATTN: SERVICE MANAGER

DATE: September 7, 1988

GAME: Laser War &amp; Secret Service

#012

SUBJECT: Fuse Change

---

SYMPTOM: Solenoid damage resulting from a shorted driver transistor.

PROBLEM: F-5 on the power supply board is a 5A slo-blo fuse. It should be a Littelfuse 4A slo-blo fuse.

SOLUTION: Change F-5 to a Littelfuse 4A slo-blo fuse.


NOTE: All fuses are not created equally. Littelfuse fuses blow appx. 20-30% faster than their competition. This is why Data East Pinball uses only Littelfuse products in our games. If you must use a fuse made by a manufacturer other than Littelfuse, we recommend you reduce the amperage by 1 amp. (ex. - A Littelfuse 5A slo-blo equals their competitors 4A slo-blo.)

Data East Pinball, Inc.

Pete Gustafson  
Field Service Manager

PG/gm

Page 1 of 2

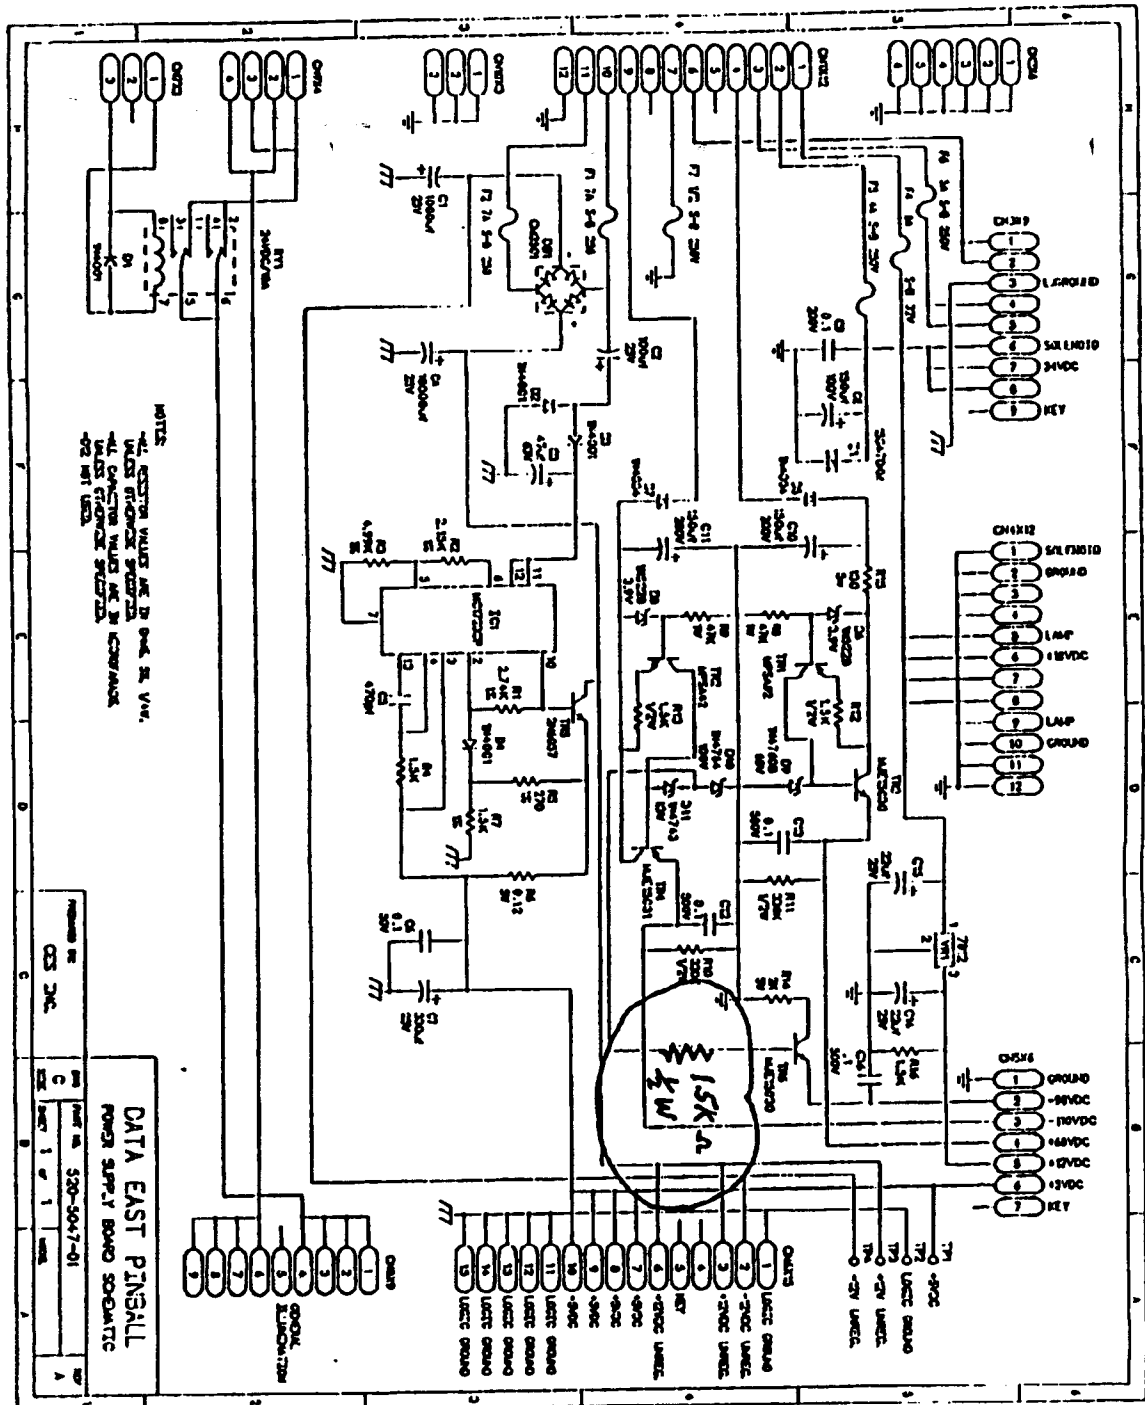

Power Supply Diagram 55