


Service Bulletin N° 98

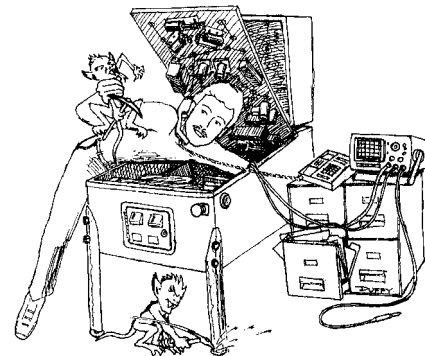

Joe Blackwell
Technical Support Manager

Eric Winston
Technical Support Engineer

Jay Alfer
Technical Support Administrator

TO: Parts & Service Managers

DATE: April 8, 1997

Addition of Reset Alignment Bracket Kit Part N° 500-6210-00.

Drop Targets intermittently stick in the "Up Position." Game vibration normally will free them.

Explanation:

The Drop Target Lift Bracket on occasion will turn & bind in the Target Support Brackets. Lubricating the side flanges that guide the Lift Bracket Up and Down will correct this problem. We recommend using White Lithium Grease or a "dry" lubricant such as Teflon Spray. **To ensure a maintenance free assembly we have added alignment brackets to all current assemblies which act as a backplate thus limiting the left & right movement of the Lift Bracket (this eliminates the need for lubrication).** Using the *Reset Alignment Bracket Kit (containing: Reset Alignment Brackets, 535-8065-00, 2 Ea. and #8-32 Keps Nut, 240-5104-00, 4 Ea.)* follow the simple procedure below in lieu of lubrication.

Attach one (1) Reset Align. Bracket **on each side** over the existing two (2) #8-32 Mounting Screws securing the Height Adj. Bracket. Secure the new brackets **on each side** with #8-32 Keps Nuts (1 per existing screw).

Manual Update:

Note the items and quantities contained in the Subject Kit into Section 4, Chapter 2, Page 77 in the Star Wars Trilogy - Special Edition Manual.

